


JX6 Full Dimensions

Swivel Nut Union Tee
37° Swivel (all three ends)

HPD Base # 069T

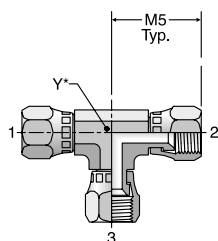

Y* – Across wrench flats


TUBE FITTING PART #	END SIZE	M5 (in.)	Y (in.)	STANDARD Dynamic Pressure (x 1,000 PSI)		
	1-3 (in.)			-S	-SS	-B
4 JX6	1/4	1.00	7/16	7.5		
6 JX6	3/8	1.25	9/16	6.0		
8 JX6	1/2	1.38	3/4	6.0		
10 JX6	5/8	1.62	3/4	5.0		
12 JX6	3/4	1.75	1 1/16	5.0		
16 JX6	1	2.00	1 3/16	4.0		

S6X Full Dimensions

Swivel Nut Branch Tee
37° Flare / 37° Flare /
37° Swivel

SAE 070433

HPD Base # 393T

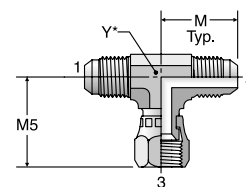

Y* – Across wrench flats


TUBE FITTING PART #	END SIZE	M (in.)	M5 (in.)	Y (in.)	STANDARD Dynamic Pressure (x 1,000 PSI)		
	1-3 (in.)				-S	-SS	-B
4 S6X	1/4	0.89	1.00	7/16	7.5	7.7	
5 S6X	5/16	0.95	1.16	9/16	6.0	6.0	
6 S6X	3/8	1.06	1.25	9/16	6.0	6.0	
8 S6X	1/2	1.25	1.38	3/4	6.0	6.0	
10 S6X	5/8	1.45	1.62	7/8	5.0	5.0	
12 S6X	3/4	1.66	1.75	1 1/16	5.0	5.0	
14 S6X	7/8	1.80	1.91	1 5/16	5.0		
16 S6X	1	1.81	2.00	1 5/16	4.0	2.5	
20 S6X	1 1/4	2.06	2.31	1 5/8	4.0	2.5	
24 S6X	1 1/2	2.33	2.67	1 7/8	3.0	2.0	

R6X Full Dimensions

Swivel Nut Run Tee
37° Flare / 37° Swivel /
37° Flare

SAE 070432

HPD Base # 063T

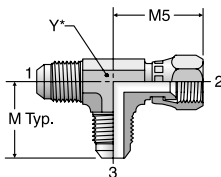

Y* – Across wrench flats

TUBE FITTING PART #	END SIZE	M (in.)	M5 (in.)	Y (in.)	STANDARD Dynamic Pressure (x 1,000 PSI)		
	1-3 (in.)				-S	-SS	-B
4 R6X	1/4	0.89	1.00	7/16	7.5	7.7	
5 R6X	5/16	0.95	1.16	9/16	6.0	6.0	
6 R6X	3/8	1.06	1.25	9/16	6.0	6.0	
8 R6X	1/2	1.25	1.38	3/4	6.0	6.0	
10 R6X	5/8	1.45	1.62	7/8	5.0	5.0	
12 R6X	3/4	1.66	1.75	1 1/16	5.0	5.0	
14 R6X	7/8	1.80	1.91	1 5/16	5.0		
16 R6X	1	1.81	2.00	1 5/16	4.0	2.5	
20 R6X	1 1/4	2.06	2.31	1 5/8	4.0	2.5	
24 R6X	1 1/2	2.33	2.59	1 7/8	3.0	2.0	

Dimensions and pressures for reference only, subject to change.

Visual
Index

How To
Order

Specs

Assembly /
Installation

3-D
CAD
Model

Reference
Section